

# Document made available under the Patent Cooperation Treaty (PCT)

International application number: PCT/IL05/000132

International filing date: 03 February 2005 (03.02.2005)

Document type: Certified copy of priority document

Document details: Country/Office: US  
Number: 60/541,256  
Filing date: 04 February 2004 (04.02.2004)

Date of receipt at the International Bureau: 31 May 2005 (31.05.2005)

Remark: Priority document submitted or transmitted to the International Bureau in compliance with Rule 17.1(a) or (b)



World Intellectual Property Organization (WIPO) - Geneva, Switzerland  
Organisation Mondiale de la Propriété Intellectuelle (OMPI) - Genève, Suisse

PCT/IL 20 05 / 00013 2  
20 MAY 2005

PA 1307920

# THE UNITED STATES OF AMERICA

**TO ALL TO WHOM THESE PRESENTS SHALL COME:**

**UNITED STATES DEPARTMENT OF COMMERCE**


**United States Patent and Trademark Office**

**April 15, 2005**


**THIS IS TO CERTIFY THAT ANNEXED HERETO IS A TRUE COPY FROM  
THE RECORDS OF THE UNITED STATES PATENT AND TRADEMARK  
OFFICE OF THOSE PAPERS OF THE BELOW IDENTIFIED PATENT  
APPLICATION THAT MET THE REQUIREMENTS TO BE GRANTED A  
FILING DATE UNDER 35 USC 111.**

**APPLICATION NUMBER: 60/541,256**

**FILING DATE: February 04, 2004**

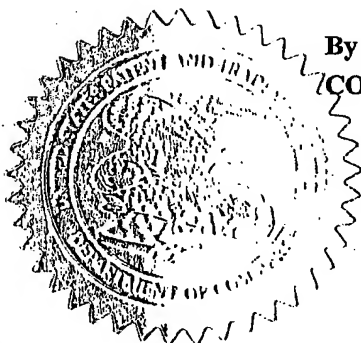

**By Authority of the  
COMMISSIONER OF PATENTS AND TRADEMARKS**

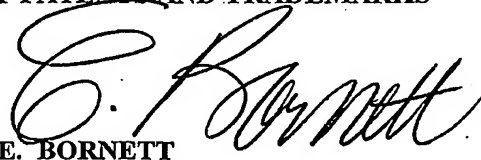  
**E. BORNETT**  
**Certifying Officer**

16398 U.S. PTO

U.S. PTO  
60/541256

020404

PTO/SB/16 (08-03)

Approved for use through 07/31/2006. OMB 0651-0032  
U.S. Patent and Trademark Office; U.S. DEPARTMENT OF COMMERCE

Under the Paperwork Reduction Act of 1995, no persons are required to respond to a collection of information unless it displays a valid OMB control number.

**PROVISIONAL APPLICATION FOR PATENT COVER SHEET**

This is a request for filing a PROVISIONAL APPLICATION FOR PATENT under 37 CFR 1.53(c).

Express Mail Label No.

INVENTOR(S)					
Given Name (first and middle (if any))		Family Name or Surname		Residence (City and either State or Foreign Country)	
MOSHE		SHOHAM		HOSHAYA, ISRAEL	
Additional inventors are being named on the _____ separately numbered sheets attached hereto					
TITLE OF THE INVENTION (500 characters max)					
A SINGLE SENSOR FOR VERIFICATION OF PARALLEL ROBOT LOCATION					
Direct all correspondence to: CORRESPONDENCE ADDRESS					
<input type="checkbox"/> Customer Number: _____					
OR					
<input checked="" type="checkbox"/> Firm or Individual Name: MAZOR SURGICAL TECHNOLOGY					
Address: 7 HAESHEL ST. P.O. BOX 3104					
Address: S. CAESAREA INDUSTRIAL PARK					
City: CAESAREA		State: _____		Zip: 38900	
Country: ISRAEL		Telephone: 4 627071		Fax: 4 6377234	
ENCLOSED APPLICATION PARTS (check all that apply)					
<input checked="" type="checkbox"/> Specification Number of Pages: 4					
<input type="checkbox"/> Drawing(s) Number of Sheets: _____					
<input type="checkbox"/> Application Date Sheet. See 37 CFR 1.76					
<input type="checkbox"/> CD(s), Number: _____					
<input type="checkbox"/> Other (specify): _____					
METHOD OF PAYMENT OF FILING FEES FOR THIS PROVISIONAL APPLICATION FOR PATENT					
<input type="checkbox"/> Applicant claims small entity status. See 37 CFR 1.27.					
<input type="checkbox"/> A check or money order is enclosed to cover the filing fees.					
<input type="checkbox"/> The Director is hereby authorized to charge filing fees or credit any overpayment to Deposit Account Number: _____					
<input checked="" type="checkbox"/> Payment by credit card. Form PTO-2038 is attached.					
FILING FEE Amount (\$) <div style="border: 1px solid black; padding: 5px; display: inline-block;">\$80.00</div>					
The invention was made by an agency of the United States Government or under a contract with an agency of the United States Government.					
<input type="checkbox"/> No.					
<input type="checkbox"/> Yes, the name of the U.S. Government agency and the Government contract number are: _____					

Respectfully submitted,

[Page 1 of 2]

Date 2/2/2004

SIGNATURE Moshe Shoham

REGISTRATION NO. \_\_\_\_\_

TYPED or PRINTED NAME Moshe Shoham

(If appropriate)

Docket Number: \_\_\_\_\_

TELEPHONE (972) 4 6270171

**USE ONLY FOR FILING A PROVISIONAL APPLICATION FOR PATENT**

This collection of information is required by 37 CFR 1.51. The information is required to obtain or retain a benefit by the public which is to file (and by the USPTO to process) an application. Confidentiality is governed by 35 U.S.C. 122 and 37 CFR 1.14. This collection is estimated to take 8 hours to complete, including gathering, preparing, and submitting the completed application form to the USPTO. Time will vary depending upon the individual case. Any comments on the amount of time you require to complete this form and/or suggestions for reducing this burden, should be sent to the Chief Information Officer, U.S. Patent and Trademark Office, U.S. Department of Commerce, P.O. Box 1450, Alexandria, VA 22313-1450. DO NOT SEND FEES OR COMPLETED FORMS TO THIS ADDRESS. SEND TO: Mail Stop Provisional Application, Commissioner for Patents, P.O. Box 1450, Alexandria, VA 22313-1450.

If you need assistance in completing the form, call 1-800-PTO-9199 and select option 2.

**PROVISIONAL APPLICATION COVER SHEET**  
**Additional Page**

PTO/SB/16 (08-03)

Approved for use through 07/31/2006. OMB 0651-0032

U.S. Patent and Trademark Office; U.S. DEPARTMENT OF COMMERCE

Under the Paperwork Reduction Act of 1995, no persons are required to respond to a collection of information unless it displays a valid OMB control number.

Docket Number

INVENTOR(S)/APPLICANT(S)		
Given Name (first and middle [if any])	Family or Surname	Residence (City and either State or Foreign Country)

**[Page 2 of 2]**

Number \_\_\_\_\_ of \_\_\_\_\_

**WARNING:** Information on this form may become public. Credit card information should not be included on this form. Provide credit card information and authorization on PTO-2038.

01-Feb-04

## **A Single Sensor for Verification of Parallel Robot Location**

Moshe Shoham  
Mazor Surgical Technologies  
P.O.Box 3104  
Caesarea S. Park 389000  
Israel

### **1. Introduction**

Robotic systems have been recently entered the medical arena for enhancing the surgeons' ability in precise and minimally invasive positioning of surgical tools. In particular, they have been used for remote manipulation (e.g. Intuitive Surgical's Davinci) as semi active devices for brain biopsies applications (e.g. Cyberknife and Neuromate) and as an active robot for hip and knee replacement (e.g. ISS's Robodoc). In order to increase the system reliability in these hazardous tasks these robots have been equipped with a double set of encoders (position sensors) that measure the actual joint motions and provide the input for an algorithm that determines the surgical tool position and orientation. Double set of sensors is used to serve as a backup for the case of an encoder (sensor) failure.

In serial type robot where the links and joints are connected in series, each joint actuator affects the end-effector location and there is no internal position sensor that measures the end-effector location. Hence each encoder is backed up by a second encoder on the same axis.

In a parallel type robot it is possible to measure the end-effector location directly relative to the base and hence to locate the second set of sensors not necessarily at the joints but rather between the base and the output.

In an earlier disclosure [1] it was suggested that for a six DOF parallel robot only three encoders are sufficient to provide the backup for sensor failure.

In the present disclosure it is shown that for any statistical significance result it is possible to use only one extra sensor (encoder) in order to provide the necessary backup for encoder failure in robots.

As an example consider a parallel robot with six extensible links as shown in Fig. 1, (It should be mentioned that the exact same analysis applies also to other parallel robots). The six extensible links are connected between the base and the moving platform with spherical joint at one side of the link and U joints at the other. In addition, each link length is measured by a position sensor (encoder) that moves with the link.

### **2. Adding one extra sensor for verification of the moving platform location**

One extra sensor- namely the 7<sup>th</sup> sensor (see Fig. 2) - is now added and measures the distance between the moving and the base platforms centers. Changing the extensible link lengths generally changes the distance between the platforms' centers and hence is detected by the 7<sup>th</sup> sensor. Since the moving platform to which the 7<sup>th</sup> sensor is connected, is a rigid body the length of the sensor is uniquely determined by the length of the six links and hence provides a backup for the case of incorrect platform position.

The main question is does this single sensor can detect any unwanted platform motion in case the link length's sensors have failed?

01-Feb-04

This theoretically might happen. For example if all the six link length sensors fail and are off by the same amount then the moving platform changes its orientation while keeping its center fix and hence keeping fix the length and the measurement of the 7<sup>th</sup> sensor.

Similarly, if three of the actuators fail and the other symmetrical three fail the same amount to the other direction then the moving platform might perform a pure rotation which is not detected by the 7<sup>th</sup> position sensor.

Our problem is to find how likely these cases, where there are combinations of sensor failures that are neither detected by the joint control system nor by the 7<sup>th</sup> sensor, might happen.

### **3. Analysis of the 7<sup>th</sup> sensor detection capability**

#### **3.1 Failure of one sensor**

Let's start the analysis with a failure of one link-length sensor.

Failing of one sensor means that the actuator moves changing its link length while closing the erroneous position signal generated by the fault sensor.

The question is what the cases are where this error is not detected by the 7<sup>th</sup> sensor.

In order to identify these problematic cases the moving platform trajectories that maintain constant the 7<sup>th</sup> sensor reading should be calculated.

In some cases the moving platform is displaced while all the actuators maintain their length. This is called a singular configuration in which the moving platforms gains an extra degree-of-freedom. Most robots as well as the application considered here are designed in such a way that all the singular configurations are out of its work envelope.

However, when one sensor fails there are still 6 known measured distances between the platforms, namely 5 link-length sensors and the 7<sup>th</sup> sensor. This constitutes a "new" robot where the 6 link lengths are measured at different locations at the platforms than the original robot one. If this "new" robot contains singular configurations within the original robot work volume it means that the moving platform is able to move without being detected by the 7<sup>th</sup> sensor and the backup system fails.

If no singular configurations exist with the robot work volume then any unwanted motion generated by an erroneous link-length sensor is detected by the 7<sup>th</sup> sensor. This is true since otherwise we have for the same position and orientation of the moving platform (determined up to a single assembly mode by the inverse kinematics from the 5 link-length sensors and the 7<sup>th</sup> sensor) two different distinct solutions for the link lengths.

To determine what the singular configurations of the "new" robot are it is required either to conduct an analytical analysis, e.g. [2,3,4] or to search the entire workspace of the manipulator.

01-Feb-04

Assuming that such singular configurations do not exist within the robot workspace, the conclusion is that there is no possible motion of the robot that can go undetected by the 7<sup>th</sup> sensor if only one encoder fails.

### 3.2 Failure of two sensors

Consider now that two sensors are simultaneously incorrect.

The likelihood of this case is quite low. Moreover, even if two sensors fail at the same time and give erroneous readings, this also is detected by the 7<sup>th</sup> sensor unless the values given by the two failed sensors are in such a proportion that matches a valid displacement of the moving platform.

In particular, when the location of the moving platform is defined by only 5 distance readings (4 link-lengths and the 7<sup>th</sup> sensor), then it is not fully defined and the platform might move freely and have infinite number locations.

Now whatever the reading of one failed sensor is it "locks" the moving platform since we are again at the previous case with only one failing sensor. It means that there is only one combination (within the current assembly mode) of the two failing sensors that match the rest 5 correctly operated sensors.

Based on this analysis the probability that the platform moves without being detected by the 7<sup>th</sup> sensor when one or two sensors simultaneously fail is calculated as follows:

1. Make sure that there is no singular points of a robot composed of 5 link-length sensors and the 7<sup>th</sup> sensor within the entire robot workspace.
2. In this case find the probability that one sensor may fail.
3. The probability that both failed simultaneously is the square of the probability that one fails.
4. The probability two fail simultaneously and give valid reading is the square of the probability one fails times the reciprocal of the number of increments (resolution) in one sensor.

### 4. Example: SpineAssist (Mazor Surgical Technology)

In the case of Mazor's SpineAssist robot the probability of one sensor to fail during an operation that lasts an hour while the sensor life time is 10,000 hours, is  $10^{-4}$ . The sensor resolution is 12 bit = 4096. Hence the probability for a mistaken motion not detected by the 7<sup>th</sup> sensor due to two failed sensors is  $10^{-4} * 10^{-4} * 4096^{-1} = 2.44 * 10^{-12}$ . The lifetime of each robot is planned to be 500 hours; hence the probability for undetected platform motion during the robot lifetime is  $1.22 * 10^{-9}$ .

Taking into consideration that the sensor reading is affected also by other factors like ADC, LVDT card and power supply the probability for an error reading during one surgery might be reduced to  $10^{-3}$ . Hence the probability for a mistaken motion not detected by the 7<sup>th</sup> sensor due to two failed sensors is  $10^{-3} * 10^{-3} * 4096^{-1} = 2.44 * 10^{-10}$ , and during the robot lifetime of 500 hours is  $1.22 * 10^{-7}$ . Noting that each robot is planned to perform 500 surgeries this accumulated to one error per the entire population on earth.

01-Feb-04

**References:**

1. PCT WO 01/19272 A1 Precision Robot with Parallel Kinematics and a redundant sensor system.
2. J-P. Merlet.  
Singular configurations of parallel manipulators and Grassmann geometry.  
*Int. J. of Robotics Research*, 8(5):45-56, Octobre 1989 .
3. J-P. Merlet.  
Determination of the presence of singularities in a workspace volume of a parallel manipulator.  
In *NATO-ASI, Computational methods in mechanisms*, Sts. Konstantin and Elena Resort, 16-28 Juin 1997
4. Ben Horin, R.: Design Parameters of Parallel Manipulators, Ph.D. Thesis, Technion, Israel, 1998.

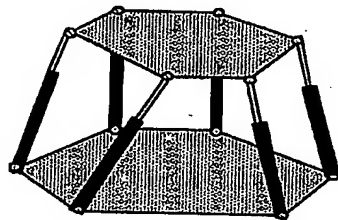


Figure 1: A six extensible links parallel robot

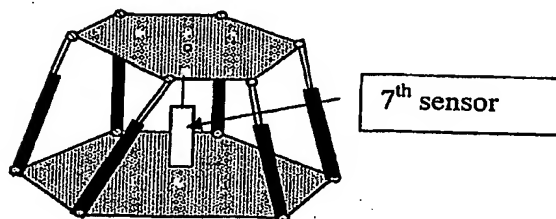


Figure 2: A six extensible links parallel robot with one redundant 7<sup>th</sup> sensor